



- Contact less Temperature Measurement
- Internal Silicon Lens
- USB Interface

DESCRIPTION

TPTV is a contact-less temperature measuring system based on the detection of infrared radiation.

TPTV is equipped with an infrared sensor (Thermopile) in front. The Thermopile Sensor has to be pointed at the target object of interest.

The basic working principle is:

- Detection of infrared radiation with a Thermopile sensor, which turns incoming radiation to an analogue voltage
- · Determination of sensor temperature using a thermistor
- Further analogue signal processing and conditioning
- · Calculation of ambient and object temperature using a processing unit
- Providing the ambient and objects temperature via USB bus

FEATURES APPLICATIONS

- 0°C 100°C Measurement Range
- USB Interface

• Contact less Temperature Measurement



ABSOLUTE MAXIMUM RATINGS

Absolute maximum ratings are limiting values of permitted operation and should never be exceeded under the worst possible conditions either initially or consequently. If exceeded by even the smallest amount, instantaneous catastrophic failure can occur. And even if the device continues to operate satisfactorily, its life may be considerably shortened.

Parameter	Symbol	Conditions	Min	Тур	Max	Unit
Supply Voltage	Vcc	Measured versus GND	-0.5		6	V
Operating Temperature	Тор		-10		85	°C
Storage temperature	Tstor		-40		85	°C

OPERATING CONDITIONS

Parameter	Symbol	Conditions	Min	Тур	Max	Unit
Supply voltage	Vcc	Measured versus GND	3.3		5.25	V
Emission Coefficient	3		0.95			

OPERATING CONDITIONS

If not otherwise noted, 25°C ambient temperature, 5V supply voltage and object with ϵ =0.98 were applied.

Parameter	Symbol	Conditions	Min	Тур	Max	Unit
Field of View	FOV			14 ¹⁾		0
Supply Current	I	Full ambient temp. range, no output load		5		mA
Data Output Rate	Fout		1			Hz

¹⁾ Total field of view at 10% signal level

OPERATIONAL CHARACTERISTICS


If not otherwise noted, 25°C ambient temperature, 5V supply voltage and object with ϵ =0.98 were applied.

Parameter	Symbol	Conditions	Min	Тур	Max	Unit
Object Temperature Range	Tobj			100		°C
Ambient Temperature Range	Tamb		0		85	°C
Standard Start-Up Time	tStart			3		S
Stabilization Time	tStab			3		min
Accuracy offset – prior to thermal stability time	ΔT_{stab}			±3 ²⁾		%FS
Accuracy tolerance when		170°C < T _{object} < 190°C		±2 ²⁾		%FS
10°C < Tambient < 40°C and after 3 minutes stabilization time	ΔΤ	Outside above range		±3 ²⁾		%FS

²⁾ The distance of sensor to measurement object has to be disclosed by customer in order to guaranty calibration accuracy.



MECHANICAL DIMENSIONS

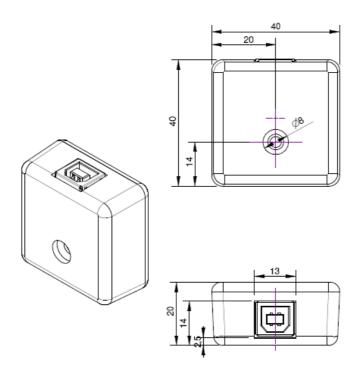


TERMINALS

Connector: Standard USB B Jack


Pin	Name	Description	Туре		
1	VCC	Supply Voltage (5V)	Supply		
2	D-	Data-	Ю		
3	D+	Data+	Ю		
4	GND	Ground	Supply		

BLOCK DIAGRAM

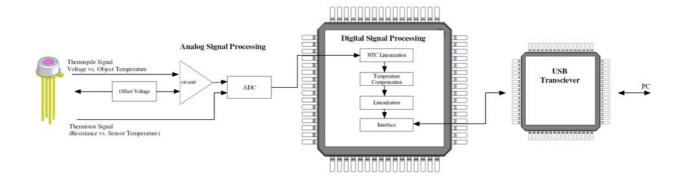




FIELD OF VIEW

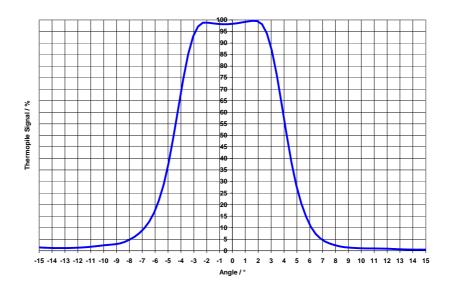

SIGNAL DISTRIBUTION

The non-ideal filter characteristics have to been considered for the correct measurement distance with respect to the measurement object surface size. To achieve most accurate measurement results, measurement object should at least cover 99% of the sensors field of view.

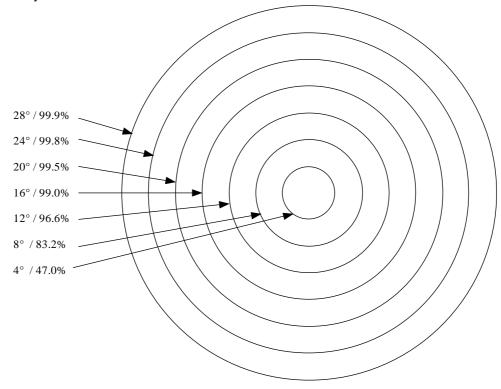



FUNCTION

INTERFACE CHARACTERISTICS

Parameter	Value	
Digital Output Type	RS232 via USB	
Data Output Rate	tbd	
Data Output Settings	9600 Baud, 8 Bit, No Parity, 1 Stop Bit	
PC Settings USB drivers will be provided. Driver is emulating a serial COM-Port.		

INTERFACE COMMAND REFERENCE

Ambient and Object Temperature Measurement

Please refer following table for interface commands to read object temperature and ambient temperature. Both values are transmitted in hundredth of degrees.

Command (ASCII)	Description	Reply (ASCII)	Bytes
"["	Object temperature	Object temperature in hundredth of degree inclusive sign	6
"n"	Ambient temperature	Ambient temperature in hundredth of degree inclusive sign	6

Example of Object Temperature Measurement

PC → Sensor	Sensor → PC	
"t" (ASCII)	"+02351"	ASCII (+23.51°C)

ORDERING INFORMATION

NORTH AMERICA EUROPE ASIA

Measurement Specialties, Inc. 910 Turnpike Road Shrewsbury, MA 01545 Tel: 1-508-842-0516

Fax: 1-508-842-0516

Sales email:

temperature.sales.amer@meas-spec.com

MEAS Deutschland GmbH Hauert 13 44227 Dortmund

Tel: +49 (0) 231/9740-0 Fax: +49 (0) 231/9740-20

Sales email:

info.de@meas-spec.com

Measurement Specialties (China) Ltd. No. 26 Langshan Road Shenzhen High-Tech Park (North) Nanshan District, Shenzhen 51807 China

> Tel: +86 (0) 755 33305088 Fax: +86 (0) 755 33305099

Sales email:

temperature.sales.asia@meas-spec.com

The information in this sheet has been carefully reviewed and is believed to be accurate; however, no responsibility is assumed for inaccuracies. Furthermore, this information does not convey to the purchaser of such devices any license under the patent rights to the manufacturer. Measurement Specialties, Inc. reserves the right to make changes without further notice to any product herein. Measurement Specialties, Inc. makes no warranty, representation or guarantee regarding the suitability of its product for any particular purpose, nor does Measurement Specialties, Inc. assume any liability arising out of the application or use of any product or circuit and specifically disclaims any and all liability, including without limitation consequential or incidental damages. Typical parameters can and do vary in different applications. All operating parameters must be validated for each customer application by customer's technical experts. Measurement Specialties, Inc. does not convey any license under its patent rights of others.